


BNC


75Ω Cable Jack Panel version

Assembly Instructions


(A)

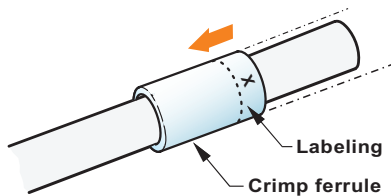


(B)

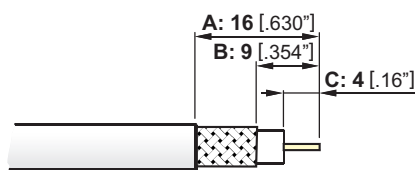

(C)

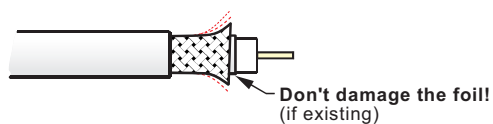


(D)

 

(A) Slide the crimp ferrule onto the cable

(B) Prepare cable as shown
- Use an adjustable coaxial cable stripper


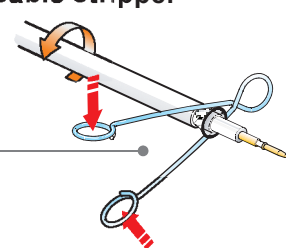
(C) Spread the braided shield
(It's easily with the Neutrik "SHIELD-SPREADING-TOOL"!) 

(D) Crimp the pin
- position the pin on the center conductor
- **Crimp the pin with the tool**
(For best crimping-results it is recommended to use the original Neutrik crimp tool
- HXBNC with the corresponding insert
or hexcrimp acc. to IEC 803-W (SW 1.7)
or squarecrimp acc. to IEC 803-2 (SW 1.6)
- **Pin can also be soldered (Optional)!**


(E) Insert the cable into the connector body

(F) Slide the crimp ferrule over the shield to the front and push the cable and leading ferrule to it's end position until you hear a snap noise.

(G) Crimp the ferrule with the tool
(For best crimping-results it is recommended to use the original Neutrik tool - HXBNC with the corresponding insert)

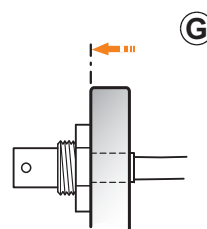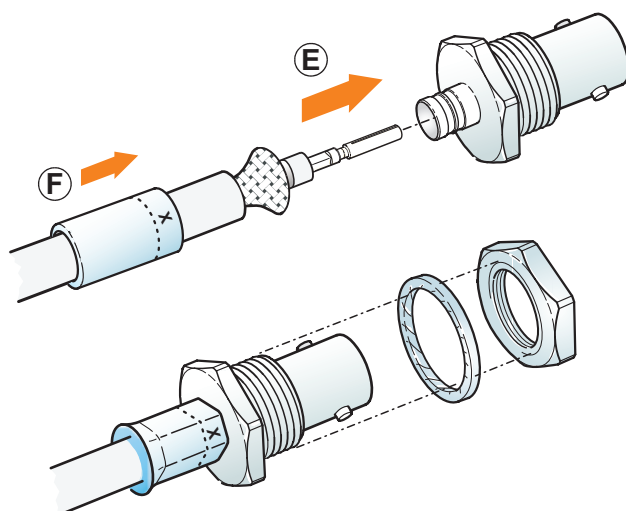

Please note:
Position the connector body
Flush with the die face.

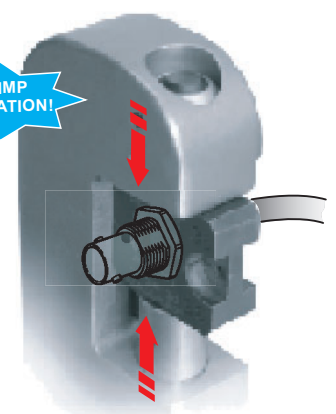

NEUTRIK AG
Liechtenstein
Tel.: +423/237 24 24
Fax: +423/232 53 93
www.neutrik.com

NEUTRIK Zürich AG
Switzerland
Tel.: +41 1/736 5010
Fax: +41 1/736 5011

NEUTRIK (UK) Ltd.
Great Britain
Tel.: +44 1983/811 441
Fax: +44 1983/811 439

NEUTRIK USA INC.
USA
Tel.: +1 732/901 9488
Fax: +1 732/901 9608

NEUTRIK Tokyo Ltd.
Japan
Tel.: +81 3/3663 4733
Fax: +81 3/3663 4796

NEUTRIK France
France
Tel.: +33 1/4131 6750
Fax: +33 1/4131 0511

NEUTRIK Vertriebs GmbH
Germany / Netherlands
Tel.: +49 8131/28 08 90
Fax: +49 8131/28 08-30

Draft Nr.: BDA 120 / 3102M1201
Update: 22.09.2004

Data subject to change without prior notice. ©2004 NEUTRIK®. ALL RIGHTS RESERVED.



NEUTRIK®
CONNECTING THE WORLD